


DATA
OUTPUT

**INSPECTION
CERTIFICATE**
TRACEABLE TO NIST

- Meet ASME B89.1.10M-2001
- Button function:
 - in/mm: short press for inch/metric conversion
long press to change measuring direction
 - ABS: short press for absolute/incremental measurement
long press to preset data
 - 0/ON: short press to turn on when power is off
short press to set zero when power is on
long press to turn off
- Keep preset data in memory after restart
- CR1632 battery, automatic power off
- Data output
- With flat back
- Optional accessory: data output cable (part no. **7315-50M, 7302-40M, 7305-40M**), contact points (page 73)

COMPACT DIGITAL INDICATORS

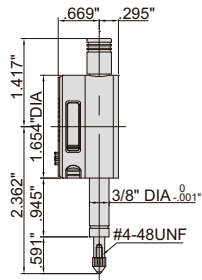

2114-51FE

Part No.	Range	Resolution	Accuracy	Hysteresis
2114-5FE*	.2"/5mm	.0005"/0.01mm	±.0015"	.0005"
2114-51FE*	.2"/5mm	.00005"/0.001mm	±.00015"	.00005"

* Supplied with manufacturer inspection certificate traceable to NIST